

TROTEC LASER CUTTER

CO2 Laser 100W Table size: 1016 x 610 mm No external materials allowed



MATERIALS

| PLYWOOD | MDF | ACRYLIC |
|---------|------|---------|
| 3 mm | 3 mm | 1 mm |
| 5 mm | 5 mm | 2 mm |
| | | 3 mm |
| | | 5 mm |



MACHINE

Turning on

After logging into the machine you will need to start it up. To do so turn the key all the way to the right.

Ventilation

Remember to check that the ventilation system is active when using the machine.

Self checks

The machine will run several self checks and calibrate the axis. This process will take a few seconds and will cause the table to move all the way down.





Moving the table

Using the buttons on the right the table can be moved up and down.





MACHINE

Insert material

- Move the table upwards to a comfortable position and place your material on the table.
- If your material is bended and lifts up at some points you need to tape it down. Make sure to place the material so that the edges are bending up when securing the material, this will guarantee the material will lay flat.







Auto focus

Now move the laser to a location above the material using the X & Y Arrows and then run the auto focus routine by pressing the Z up and down buttons at the same time.






COREL DRAW

Set the file

Open a new file in Corel Draw and make sure that the file size is 1016×610 mm.

Importing files

You can import vector files by dragging them on the Corel Draw page or create your own file with Corel Draws tools.

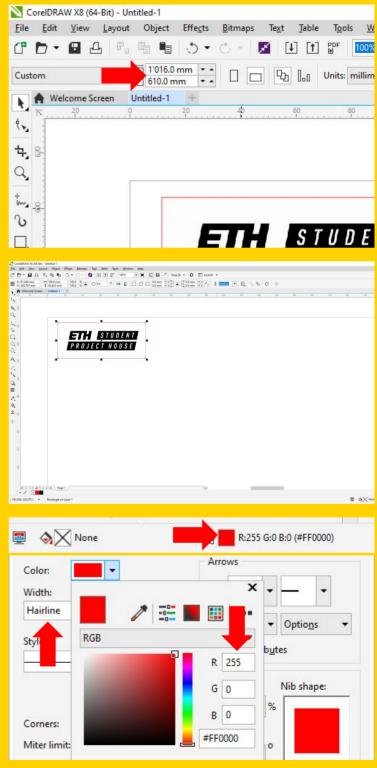

Line setting

The lines that need to be cut have to be RGB RED (255,0,0) with a thickness of Hairline.



PREPARE FILE FOR CUTTING

Engraver Settings


Once you are done either press Ctrl + P or click on print under the file tab. Then select the [Trotec Engraver] and click [Preferences].

Preferences

- Ensure the settings are the same as shown in the 3 red boxes on the right.
- Select the material you want to use.
- The following 2 settings may be adjusted. The engraving Resolution and the engraving pattern (Halftone).
- Once you are done press the big "JC" button.



When everything is set up press the [Print] button to send your file to the cutter software.

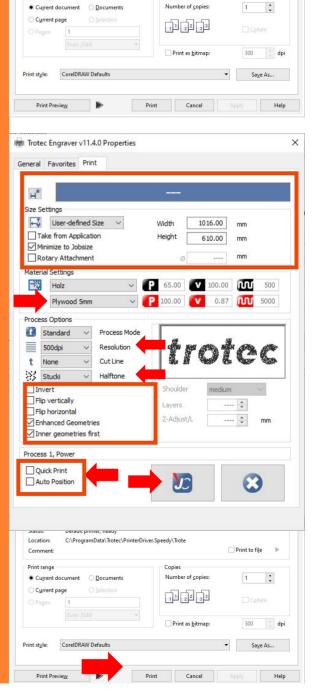

General Color Composite Layout Prepress S No Issues

Match orientation (Landscape)

C:\ProgramData\Trotec\PrinterDriver.Speedy\Trote

Copies

▼ Preferences...

Print to file

•

- Use PPD

Trotec Engraver v11.4.0

Default printer: Ready

Destinatio Pri<u>n</u>ter:

P<u>ag</u>e: Status:

Locatio

Comment:

Print range



JOB CONTROL

A new software named "Job Control" opens. The first step is to connect the software to the machine by pressing the small USB plug on the right side. The machine will take a second to synchronize.

| TROTEC JobControl® 11.4.0 - [Plate1] | | - | o x |
|---|---------------------------------------|--------------|---------------|
| 🔁 File Edit Engewere Plate Settings View Window Help | | | _ = × |
| Holz 🕐 Phywrod Smrm 🕐 🎇 5.00 😰 50.00 🐼 500 😰 50.00 🚾 6.67 🚾 5000 🖝 | | | |
| Nden X 2 4 6 6 10 12 14 16 18 22 24 26 28 30 22 24 26 38 40 42 44 64 49 12 24 16 58 30 62 64 66 58 70 72 74 76 76 78 50 62 64 68 99 5 | ses | | 0 × |
| Cut 100.00 3 Power, 0.87 3 Sored, 3000 Hz | Jobname | A R | |
| | SPH_Logo.cdr | 500 | 2/12/202 |
| | | | |
| | | | |
| | | | |
| Jobs SPH Logo cd | | | |
| Polyan, 100, 0001 12 | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| 2 | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| Pognatio E | | | |
| | ٢. | | > Show all |
| | Filter: none | | |
| | Duration: | | <1:55 🕐 |
| | 🔽 Job pre | zview | |
| | ET | и с я | 10111 |
| | i i i i i i i i i i i i i i i i i i i | H SIL | 6 V S E |
| | | | _ |
| | | | |
| | | | |
| | | | |
| | | | |
| | Ready | O Fib | r 😐 |
| | | | ^ |
| | | | |
| Cacuation Quettors | | | |

Select your job from the list on the right and drag it onto the virtual machine table left to it. The current laser position is indicated with the small crosshair. You can use it to position your job on the print bed.

| TROTEC JobControl @ 11.4.0 - (Plate1) | | - 0 > | |
|--|--|-----------------------------|----------|
| File Edit Engraver Plate Settings View Win | Mar Hab | - 5 / | _ |
| | 3.00 😰 65.00 🕑 100.00 💇 500 😰 100.00 🙋 0.87 👿 5000 🛹 📄 | | <u> </u> |
| Vectors × | 2 4 6 8 10 12 4 16 16 20 22 22 23 20 22 23 25 20 60 42 44 64 40 50 52 54 55 50 60 42 44 56 60 70 72 74 76 76 90 46 64 66 66 70 72 74 76 76 90 46 66 66 70 72 74 76 76 90 46 66 66 70 72 75 75 75 75 75 75 75 75 75 75 75 75 75 | Jobs S | а× |
| Cut: 100.00 % Power, 0.87 % Speed, 5000 Hz | | Jobname A.R., Date | |
| La 100.00 A POWR, U.S. A Speed, 500/H2 | | 「社 SPH-Lago odt 560 2/12/20 | 21 |
| Jobs SPH_Loga.cdi 10 | | | |
| Pégen 602 0.01) | | | |
| Regnarks | | | |
| | | < | |
| | | Filter: none Show a | |
| 1 ° | | Duration: <1:65 C | 9 |
| 4 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 | | V Job proven | |
| Calculation Vectors | | | 1 |
| Concentration Procession | | | 21 |



JOB CONTROL

When clicking on your job on the table you can see a small preview on the right to verify you selected the correct job.


| I TROTEC JobControl # 11.4.0 - [Plate1] | | - | ø × |
|---|---------|------------------|------------------|
| (2) File Edit Engraver Plate Settings View Window Help | | | - ~ × |
| i Holz 💌 Pywood fana 👻 🔀 5.00 🕼 100.00 💯 100.00 💯 100.00 🖉 6.57 💯 100.00 🖉 | | | |
| Weley X 2 4 6 8 10 12 14 15 18 20 22 24 25 29 20 24 35 38 40 42 44 46 48 20 22 14 55 58 80 62 14 66 68 70 72 74 76 76 80 62 14 56 88 90 | Jobs | | 0 × |
| Cat 100.03 TP-www. 8/F X Speed. 5000H | Jobname | | Date 2/12/202 |
| Adds SPK1 Logued 0 | | | |
| Pages 190.100 | | | |
| Regnatio | | | |
| | < File | : none | > Show all |
| | | | (1:55 🕐 |
| | | lob preview | 1.00 0 |
| | | | |
| | | ETH BU ATTRAC | UDEKT |
| | 6 |] 🗆 | 7 |
| | Rea | dy 😑 Fil | ber 😐 |
| | | | |
| (Caracterian Waters) | | | |

By pressing the small play button on the right, the job will be sent to the machine. The ventilation will turn on automatically and the job will start after 5 seconds.

| IROTE Job Control @ 11.4.0 - [Plote1] | _ | | σ | × |
|--|----------------|--|--------------------|-----------------|
| 🔆 File £dd: Engraver Plate Settings View Window Help | | | | . e x |
| Hele 🕐 Pywweed Sense 🔹 🕅 😧 5.00 😰 50.00 🔯 500.00 🚮 500 🚱 60.00 🐨 500.00 🚱 500 🚱 🖛 | | | | |
| Wedon X 2 4 6 8 10 12 14 15 15 20 22 24 26 28 20 22 24 36 28 40 42 44 46 48 50 52 54 55 58 50 52 54 55 58 70 72 74 75 76 80 52 54 56 88 59 5 | Jobs | | | 0 × |
| | Jobn 10 SPH | | L. Date 00 2/12 | |
| Jobs SPH_Logs.cd 10 | | | | |
| PAges 100.307 | | | | |
| Reginal a | | | | |
| | | Filte: none Duration: I dob preview Reach | Shc (1:55 | , ovral 0 |
| | | | | |
| Calculation (Litedars | | | | |
| | | | | |



SAFETY

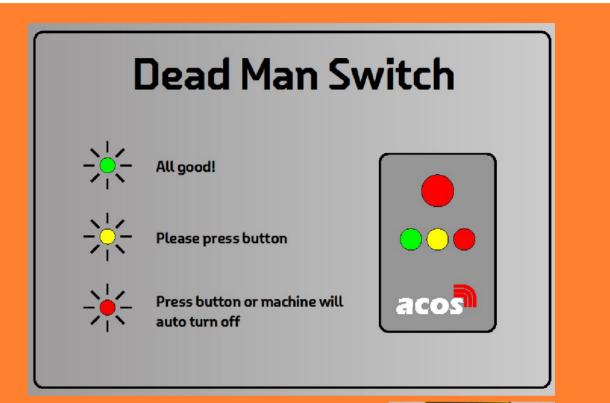

A job can be stopped using the stop button on the control panel. In case of emergency press the safety off on top of the control panel.





SAFETY RULES

- NEVER leave the cutter unattended
- ALWAYS use our presets
- **NEVER** change the presets
- **NEVER** use unknown materials
- ALWAYS ask when in doubt
- Keep the door closed for one minute after the job is done

